


LOG OF SOIL BORING #01 AT FR 3132 OVER SWEIGER CREEK

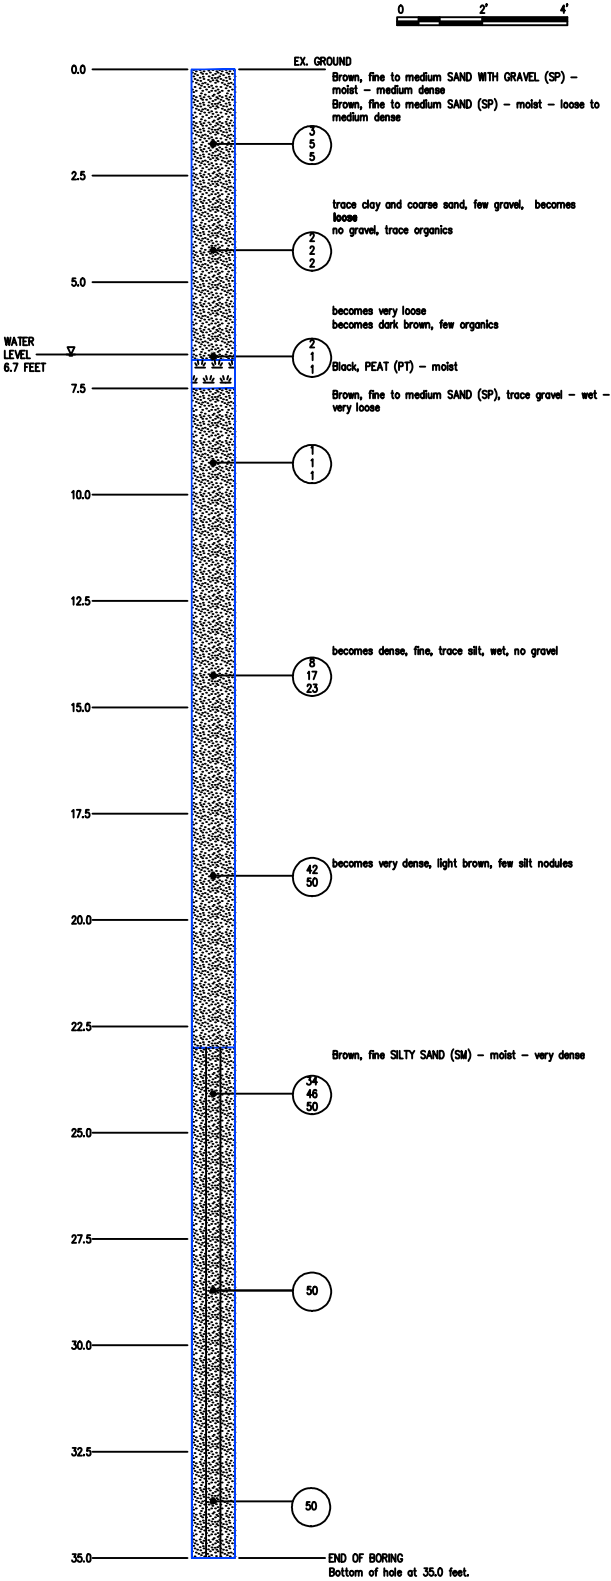

GENERAL SHEET NOTES

- NUMBERS IN CIRCLES REPRESENT THE NUMBER OF BLOWS REQUIRED TO DRIVE A 2 INCH O.D. SPLIT SPOON SAMPLER 3 SUCCESSIVE 6 INCH INCREMENTS USING 140 LB HAMMER FALLING 30 INCHES.
- DUE TO THE SOIL CONDITIONS, THE GROUND WATER LEVEL IN BORING SB#1 WAS NOT OBSERVED DURING DRILLING. WATER LEVELS MAY BE INFLUENCED BY RESIDUAL BORING WATER, AND BY SEASONAL FLUCTUATIONS.
- THE SOIL BORING LOGS REPRESENT POINT INFORMATION. PRESENTATION OF THIS INFORMATION IN NO WAY IMPLIES THAT SUBSURFACE CONDITIONS ARE THE SAME AT LOCATIONS OTHER THAN THE EXACT LOCATION OF THE BORING.
- THE SOIL BORINGS WERE DRILLED AND LOGGED BY NORTHWEST DESIGN GROUP, INC. ON 8/28/2012.
- VALUES LABELED "TV" REPRESENT TORVANE SHEAR STRENGTH MEASUREMENTS.
- SEE GENERAL PLAN OF SITE FOR LOCATIONS OF BORING.

NDG Northwest Design Group
CONSULTING ENGINEERS



U.S. DEPARTMENT OF AGRICULTURE
FOREST SERVICE
EASTERN REGION (R9)

FOREST:

HIAWATHA NATIONAL FOREST
ST. IGNACE/SAULT STE. MARIE
RANGER DISTRICT

DESIGN: NWL
DRAWN: MAS
CHECKED: LCP
DATE: 03.12.13

SHEET TITLE:

SOIL BORINGS
FR 3132 OVER SWEIGER CREEK

SUB SHEET:

C-401

PROJECT NO.:

44N4W18-001

SHEET

9

OF

10